



















| | | | |
|----------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|-------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|
| Flooring Type Tipo de pavimento Belagsart |  | EN 13845/ EN 13553 | Safety flooring Suelo de seguridad antideslizante Sicherheitsbodenbelag |
| Classification for use Areas de uso Einsatzbereiche |  | EN 685 | 34 & 43 34 y 43 34 & 43 |
| Slip Resistance Resistencia al deslizamiento Rutschsicherheit |  | TRRL EN 13845 EN 13893 DIN 51130 / DIN51097 CTE | ≥ 36 Esf / ESb DS R10 / Class B Clase 3 |
| Thickness Espesor Total Gesamtdicke |  | EN 428 | 2 mm |
| Flexibility Flexibilidad Flexibilität |  | EN 435 | Pass Conforme bestanden |
| Wear Layer Capa de uso Nutzschicht |  | EN 429 | 2 mm |
| Weight Peso Flächengewicht |  | EN 430 | 2.4 kg/m ² |
| Roll Dimensions Dimensiones del rollos Rollenabmessungen |  | EN 426 | 2 m x 20 m = 40 m ² |
| Light Fastness Resistencia a la luz Lichtechtheit |  | EN 20105-B02 | ≥ 6 |
| Sound Insulation Aislamiento acústico Trittschal |  | ISO 140-8 | 5 dB (subject to validation) |
| Wear Resistance Abrasión Verschleißverhalten |  | EN 13845 | <10% particles lost over 50000 Cycles <10% de las partículas perdidas en 50.000 ciclos <10% Partikel wurden über 50000 Umdrehungen verloren |
| Indentation Punzonamiento Resteindruck |  | EN 433 | ≤ 0.10mm |
| Fire Performance Reacción al fuego Brandverhalten |  | EN 13501-1 EN ISO 9239-1 EN ISO 11925-2 | Class Bfl s1 ≥ 8kW/m ² Pass Clase Bfl s1 ≥ 8kW/m ² Conforme Klasse Bfl-s1 ≥ 8kW/m ² , bestanden |
| Chemical Resistance Resistencia a los productos químicos Chemikalieneinwirkung** |  | EN 423 | Good Buena beständig |
| Castor Chair Abrasion Huellas de sillas de ruedas Stuhlrollenbeanspruchung |  | EN 425 | Pass Conforme geeignet |
| Under floor heating Calefacción por el suelo Fußbodenheizung |  | EN 12667 | Suitable Apto geeignet |
| Electrical Behaviours Características eléctricas Elektrisches Verhalten |  | EN 1815 | ≤ 2 kV Antistatic ≤ 2 kV Antiestáticas ≤ 2 kV antistatisch |
| Biocide Bakteriostat Bacteriostático |  | | Contains Integral Biocide Enthält Bakteriostat Contiene agente bacteriostático Integral |

Please refer to local building regulations/codes of practice.


** Caution Ketone/Aromatic Solvents. Please contact Altro for further technical advice regarding staining and chemical resistance.

Installation and Maintenance

All Installations in accordance with Altro safety flooring instructions and Local Codes of Practice. Please refer to Altro Cleaning Card for maintenance advice. Failure to install and maintain Altro flooring in accordance with installation instructions can affect its performance and slip resistance. Floors should be protected from other trades and thoroughly cleaned before handover. Darker colours are more prone to showing limescale deposits. Limescale may be easily removed with an appropriate cleaning product. This product has never contained phthalate plasticisers.

All information is correct at the time of print and is subject to change without prior notice.

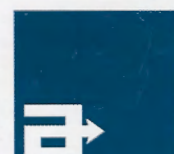
Visit us at www.altro.com for more information and updates.



Altro Limited a company certified by SGS to ISO 9001 and ISO 14001.



Contains recycled material



EN14041
0120
GB06/72664

Manufactured by:
Altro Ltd, Works Road
Letchworth Garden City
SG6 1NW, United Kingdom

EN13845

Distributor label